

## Errata

- The SPI can Send Wrong Byte
- Reset During EEPROM Write
- SPI Interrupt Flag can be Undefined After Reset
- Verifying EEPROM in System
- Serial Programming at Voltages below 3.0 Volts
- Skip Instruction with Interrupts

### 6. The SPI can Send Wrong Byte

If the SPI is in master mode, it will restart the old transfer if new data is written on the same clock edge as the previous transfer is finished.

#### Problem Fix/Workaround

When writing to the SPI, first wait until it is ready, then write the byte to transmit.

### 5. Reset During EEPROM Write

If reset is activated during EEPROM write the result is not what should be expected. The EEPROM write cycle completes as normal, but the address registers are reset to 0. The result is that both the address written and address 0 in the EEPROM can be corrupted.

#### Problem Fix/Workaround

Avoid using address 0 for storage, unless you can guarantee that you will not get a reset during EEPROM write.

### 4. SPI Interrupt Flag can be Undefined After Reset

In certain cases when there are transitions on the SCK pin during reset, or the SCK pin is left unconnected, the start-up value of the SPI interrupt flag is unknown. If the flag is not reset before enabling the SPI interrupt, a pending SPI interrupt may be executed.

#### Problem Fix/Workaround

Clear the SPI interrupt flag before enabling the interrupt.

### 3. Verifying EEPROM in System

EEPROM verify in In-System Programming mode cannot operate with maximum clock frequency. This is independent of the SPI clock frequency.

#### Problem Fix/Workaround

Reduce the clock speed, or avoid using the EEPROM verify feature.

### 2. Serial Programming at Voltages below 3.0 Volts

At voltages below 3.0 Volts, serial programming might fail.

#### Problem Fix/Workaround

Keep VCC at 3.0 Volts or higher during In-System Programming

### 1. Skip Instruction with Interrupts

A skip instruction (SBRS, SBRC, SBIS, SBIC, CPSE) that skips a two-word instruction needs three clock cycles. If an interrupt occurs during the first or second clock cycle of this skip-instruction, the return address will not be stored correctly on the stack. In this situation, the address of the second word in the two-word instruction is stored. This means that on return from interrupt, the second word of the two-word command will be decoded and executed as an instruction. The AT90S4414 has two two-word instructions: LDS and STS.

Note: This can only occur if all of the following conditions are true:

- A skip instruction is followed by a two-word instruction.
- The skip instruction is actually skipping the two-word instruction.



## 8-Bit AVR<sup>®</sup> Microcontroller with 8K bytes In-System Programmable Flash

## AT90S8515 Rev. B Errata Sheet

Rev. 1195B-01/99





- Interrupts are enabled, and at least one interrupt source can generate an interrupt.
- An interrupt arrives in the first or second cycle of the skip instruction.

Note 2: This will only cause problems if the address of the following LDS or STS command points to an address beyond 400 Hex.

**Problem Fix/Workaround**

For C-programs, use the IAR compiler version 1.40b or later. The compiler will never generate the sequence.

For assembly program, avoid skipping a two word instruction if interrupts are enabled.



## Atmel Headquarters

### *Corporate Headquarters*

2325 Orchard Parkway  
San Jose, CA 95131  
TEL (408) 441-0311  
FAX (408) 487-2600

### *Europe*

Atmel U.K., Ltd.  
Coliseum Business Centre  
Riverside Way  
Camberley, Surrey GU15 3YL  
England  
TEL (44) 1276-686677  
FAX (44) 1276-686697

### *Asia*

Atmel Asia, Ltd.  
Room 1219  
Chinachem Golden Plaza  
77 Mody Road  
Tsimshatsui East  
Kowloon, Hong Kong  
TEL (852) 27219778  
FAX (852) 27221369

### *Japan*

Atmel Japan K.K.  
Tonetsu Shinkawa Bldg., 9F  
1-24-8 Shinkawa  
Chuo-ku, Tokyo 104-0033  
Japan  
TEL (81) 3-3523-3551  
FAX (81) 3-3523-7581

## Atmel Operations

### *Atmel Colorado Springs*

1150 E. Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906  
TEL (719) 576-3300  
FAX (719) 540-1759

### *Atmel Rousset*

Zone Industrielle  
13106 Rousset Cedex, France  
TEL (33) 4 42 53 60 00  
FAX (33) 4 42 53 60 01

---

### *Fax-on-Demand*

North America:  
1-(800) 292-8635  
International:  
1-(408) 441-0732

### *e-mail*

[literature@atmel.com](mailto:literature@atmel.com)

### *Web Site*

<http://www.atmel.com>

### *BBS*

1-(408) 436-4309

### © Atmel Corporation 1999.

Atmel Corporation makes no warranty for the use of its products, other than those expressly contained in the Company's standard warranty which is detailed in Atmel's Terms and Conditions located on the Company's web site. The Company assumes no responsibility for any errors which may appear in this document, reserves the right to change devices or specifications detailed herein at any time without notice, and does not make any commitment to update the information contained herein. No licenses to patents or other intellectual property of Atmel are granted by the Company in connection with the sale of Atmel products, expressly or by implication. Atmel's products are not authorized for use as critical components in life support devices or systems.

Marks bearing ® and/or ™ are registered trademarks and trademarks of Atmel Corporation.

Terms and product names in this document may be trademarks of others.



Printed on recycled paper.

1195B-01/99/xM